



FIELD SERVICE BULLETIN # 009

Problem: The need for additional cooling during operation.

Solution: Use high-pressure fans. (Order Fan Upgrade Kit ñ P/N 600-104733)

Procedure:

- ∑ Remove the rear filter cover. (Fig 1)
- ∑ Open the upper chassis and remove the air guide. (Fig 2)
- ∑ Remove the hardware that secures the fan chassis. Hardware is under rear filter and can be seen after the rear filter cover/filter are removed.
- ∑ Disconnect fan cables. (Fig 3)

**IMPORTANT: Note direction of arrows on the fans. (Airflow)
Airflow is from the rear to front of imagesetter.**

- ∑ Remove the hardware that secures the old fans to the fan chassis. (Fig 3)
- ∑ Assemble the new fans to the fan chassis.
- ∑ Connect the fan cables.
- ∑ Assemble the filter/filter cover and the air guide back onto the unit.

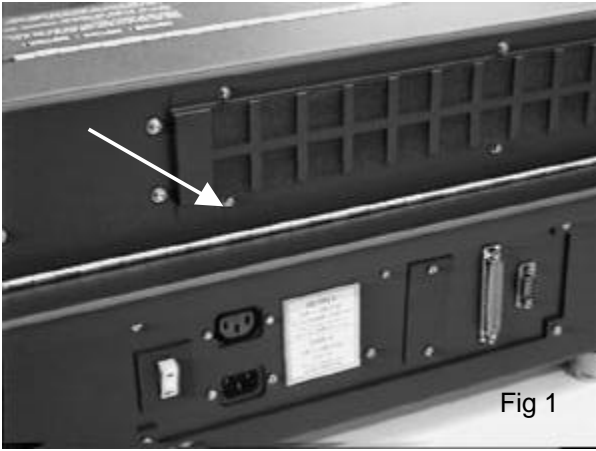


Fig 1

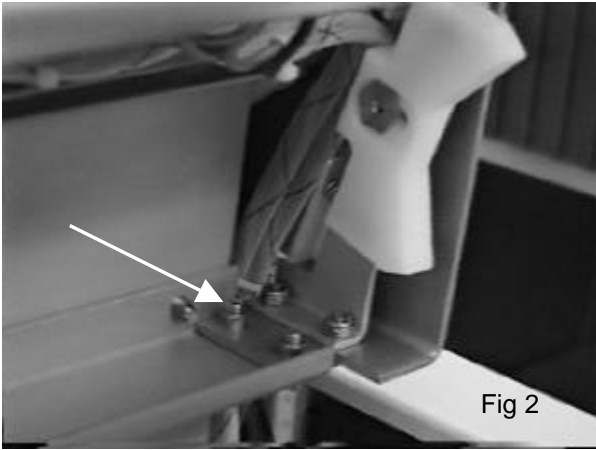


Fig 2

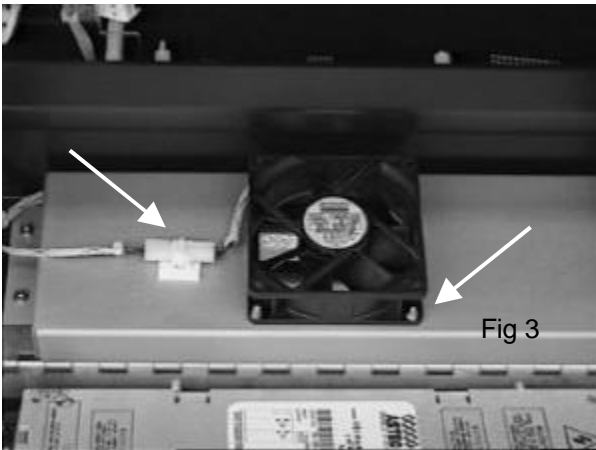


Fig 3